

# Work Order ID 73841

Friday, September 16, 2011 12:32:37 PM



Page 1

Item ID: D2661-1

Accept



Setup Start



Revision ID:

Stop



Item Name: Saddle, LH Fwd Aft Out 206

Start Date: 9/16/2011 Start Qty: 10.00



Cust Item ID:

Required Date: 11/4/2011 Req'd Qty: 10.00

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

Draw Nbr

Revision Nbr

D2661

Rev D

100

0.00



HAAS CNC VERTICAL MACHINING #1

HAAS 1

Memo

0.00

HAAS CNC vertical machine #1

Program part number and batch number. ☐ Fixturing Inspection last completed  
by 11.10.11 1-Machine Step No 1 of Folio and visually inspect as  
per attached Dimension Sheet ☐ 2-Machine Step No 2 of Folio and visually  
inspect as per attached Dimension

RP 11.10.20 10

SL 11-10-20

110

0.00



CONVENTIONAL MILLING MACHINE

Mill Conv

Memo

0.00

Conventional Milling Machine

Machine Keyway and inspect per attached dimension sheet

RP 11.10.20 10

SL

120

0.00



QC2- Inspect parts off machine FAI/FAIB

QC

Memo

0.00

Quality Control

RP 11.10.20

SL

10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 73841

Friday, September 16, 2011 12:32:37 PM



Page 2

Item ID:	D2661-1	Accept		Setup	Start	
Revision ID:					Stop	
Item Name:	Saddle, LH Fwd Aft Out 206					
Start Date:	9/16/2011	Start Qty:	10.00		Cust Item ID:	
Required Date:	11/4/2011	Req'd Qty:	10.00		Customer:	
Reference:						

Approvals:	Process Plan:	Date:	Tooling:	Date:	Run	Start	
	QC:	Date:	SPC (Y/N):	Date:		Stop	

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130	QC8- Inspect parts - second check	0.00							
QC	Memo	0.00		11/10/21		10			
Quality Control									

140	Chemical Conversion Coat per QSI005 4.1	0.00							
HandFinish	Memo	0.00				104		11/10/21	
Hand Finishing						counted			

150	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
Powdercoat	Memo	0.00							
Powder Coating									

W117745

10:50  
START TIME: 12:20  
FINISH TIME: 32006  
OVEN TEMPERATURE:

10x6 m 11/10/21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 73841**

Page 3

Friday, September 16, 2011 12:32:37 PM

Item ID: D2661-1

Accept



Setup Start



Revision ID:

Stop



Item Name: Saddle, LH Fwd Aft Out 206

Start Date: 9/16/2011 Start Qty: 10.00



Cust Item ID:

Required Date: 11/4/2011 Req'd Qty: 10.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

160

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

10 BR 11-10-24

170

Identify as per dwg &amp; Stock Location: 81435 0.00



Packaging

Memo

0.00

Packaging

8P 11-10-25

180

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11/10/25

11-10-25  
(10)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Friday, September 16, 2011 12:32:34 PM

Page 1

Work Order ID: 73841



Parent Item: D2661-1



Parent Item Name: Saddle, LH Fwd Aft Out 206

Start Date: 9/16/2011

Required Date: 11/4/2011

Start Qty: 10.00

Required Qty: 10.00

Comments: IPP: C000.11.01 Removed P/O for Powder Coat - in house process EC  
IPP Rev:D As per Rev D 07-03-19 JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6101-003

Manufactured

No

100

Each

13.0000

1

10



11-10-20

Saddle Billet, 7075

Location

Loc Qty

Loc Code

MAT040

8

72226

8

MAT44

5

72226

5

73775

10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



<b>DART AEROSPACE LTD</b>	<b>Work Order:</b>	73841
<b>Description:</b> 206 Saddle, Outboard, Left side	<b>Part Number:</b>	D2661-1
<b>Inspection Dwg:</b> D2661 Rev. D		Page 1 of 1

Inspect dimensions highlighted on inspection sheet drawing D2661 Rev. D and record below:

				Recorded Actual Dimensions					
Dim	Min	Max	Go/No Go Gauge	1	2	3	4	By	Date
A	0.100	0.140		.130	.130	.130	.130	.130	
B	0.100	0.140		.120	.120	.120	.120	.120	
1.125-1.145 C	<del>1.250</del>	1.270		1.135	1.135	1.135	1.135	1.135	
D	0.615	0.685		.680	.680	.680	.680	.680	
1.313-1.343 E	<del>0.240</del>	0.260		.250	.250	.250	.250	.250	
F	<del>1.437</del>	1.467		1.323	1.323	1.323	1.323	1.323	
G	0.210	0.230		.220	.220	.220	.220	.220	
H	0.100	0.180		.140	.140	.140	.140	.140	
I	2.470	2.510		2.490	2.490	2.490	2.490	2.490	
J	1.565	1.585		1.574	1.574	1.574	1.574	1.574	
K	0.235	0.240		.238	.238	.238	.238	.238	
L	0.100	0.120		.109	.109	.109	.109	.109	
M	0.990	1.010		1.000	1.000	1.000	1.000	1.000	
N	0.510	0.515		.512	.512	.512	.512	.512	
O	5.990	6.010		5.997	5.997	5.997	5.997	5.997	
P	1.245	1.255		1.250	1.250	1.250	1.250	1.250	
Q	2.495	2.505		2.500	2.500	2.500	2.500	2.500	
R	0.313	0.318		.313	.313	.313	.313	.313	
S	0.315	0.322		.316	.316	.316	.316	.316	
T	2.495	2.505		2.500	2.500	2.500	2.500	2.500	
U	1.357	1.367		1.362	1.362	1.362	1.362	1.362	
V	0.787	0.807		.794	.794	.794	.794	.794	
W	0.540	0.560		.550	.550	.550	.550	.550	
X	1.674	1.684		1.679	1.679	1.679	1.679	1.679	
Y	0.257	0.262		.257	.257	.257	.257	.257	
Z	0.912	0.932		.920	.920	.920	.920	.920	
AA	0.490	0.510		.499	.499	.499	.499	.499	
AB	0.178	0.198		.188	.188	.188	.188	.188	
AC									
AD									
AE									
AF									
Accept/Reject									

Measured by: <u>RF</u>
Date: <u>11.10.20</u>

Audited by: <u>cmx</u>
Date: <u>11/10/21</u>

Rev	Date	Change	Revised by	Approved
A		New Issue	RF	
B	99.04.19	Incorporated DSI 9095, DSI 9102 & DSI 9122 Rev. A	RF	
C	99.11.11	Added Dim. R-T	RF	
D	02.12.12	Reformat; Added Dim. U-W & DT8683, DT8686	KJ/RF	
E	06.07.05	Revised per drawing revision C	KJ/JLM	
F	07.03.21	Revised per drawing revision D	KJ/JLM	

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b>	<u>73841</u>
<b>Description:</b> 206 Saddle, Outboard, Left side	<b>Part Number:</b>	D2661-1
<b>Inspection Dwg:</b> D2661 Rev. D		Page 1 of 1

Inspect dimensions highlighted on inspection sheet drawing D2661 Rev. D and record below:

				Recorded Actual Dimensions					
Dim	Min	Max	Go/No Go Gauge	1	2	3	4	By	Date
A	0.100	0.140		.122	.124	.136	.130	.130	
B	0.100	0.140		.120	.120	.120	.120	.120	
C	<del>1.250</del>	<del>1.270</del>		1.135	1.134	1.135	1.135	1.135	
D	0.615	0.685		.680	.680	.680	.680	.680	
E	0.240	0.260		.246	.250	.250	.250	.250	
F	<del>1.437</del>	<del>1.467</del>		1.319	1.323	1.323	1.323	1.323	
G	0.210	0.230		.222	.220	.220	.220	.220	
H	0.100	0.180		.140	.140	.140	.140	.140	
I	2.470	2.510		2.490	2.490	2.490	2.490	2.490	
J	1.565	1.585		1.575	1.575	1.574	1.574	1.574	
K	0.235	0.240		.238	.238	.238	.238	.238	
L	0.100	0.120		.109	.109	.109	.109	.109	
M	0.990	1.010		1.000	1.000	1.000	1.000	1.000	
N	0.510	0.515		.512	.512	.512	.512	.512	
O	5.990	6.010		5.997	5.997	5.997	5.997	5.997	
P	1.245	1.255		1.250	1.250	1.250	1.250	1.250	
Q	2.495	2.505		2.500	2.500	2.500	2.500	2.500	
R	0.313	0.318		.313	.313	.313	.313	.313	
S	0.315	0.322		.316	.316	.316	.316	.316	
T	2.495	2.505		2.500	2.500	2.500	2.500	2.500	
U	1.357	1.367		1.362	1.362	1.362	1.362	1.362	
V	0.787	0.807		.792	.794	.794	.794	.794	
W	0.540	0.560		.550	.550	.550	.550	.550	
X	1.674	1.684		1.679	1.679	1.679	1.679	1.679	
Y	0.257	0.262		.257	.257	.257	.257	.257	
Z	0.912	0.932		.920	.920	.920	.920	.920	
AA	0.490	0.510		.499	.499	.499	.499	.499	
AB	0.178	0.198		.188	.188	.188	.188	.188	
AC									
AD									
AE									
AF									
Accept/Reject									


Measured by:	<u>SL</u>	<u>Rq</u>
Date:	<u>11-10-20</u>	<u>11-10-20</u>

Audited by:	<u>cmf</u>
Date:	<u>11/10/21</u>

Rev	Date	Change	Revised by	Approved
A		New Issue	RF	
B	99.04.19	Incorporated DSI 9095, DSI 9102 & DSI 9122 Rev. A	RF	
C	99.11.11	Added Dim. R-T	RF	
D	02.12.12	Reformat; Added Dim. U-W & DT8683, DT8686	KJ/RF	
E	06.07.05	Revised per drawing revision C	KJ/JLM	
F	07.03.21	Revised per drawing revision D	KJ/JLM	




DESIGN	<i>PH</i>	DRAWN BY	<i>CB</i>	DART AEROSPACE USA, INC.
				PORT HADLOCK, WA
CHECKED	<i>PH</i>	APPROVED	<i>PH</i>	DRAWING NO. D2661
				REV. D SHEET 1 OF 1
DATE	06.11.08	TITLE	SADDLE OUTSIDE	SCALE 1:3
A	97.03.25	NEW ISSUE		
B	97.07.11	ANGLE AND NOTES ADDED		
C	06.05.29	INCORPORATE DEO 9122, 9102, 9095		
D	06.11.08	RO.188 WAS RO.30; Ø0.316 WAS Ø0.313		

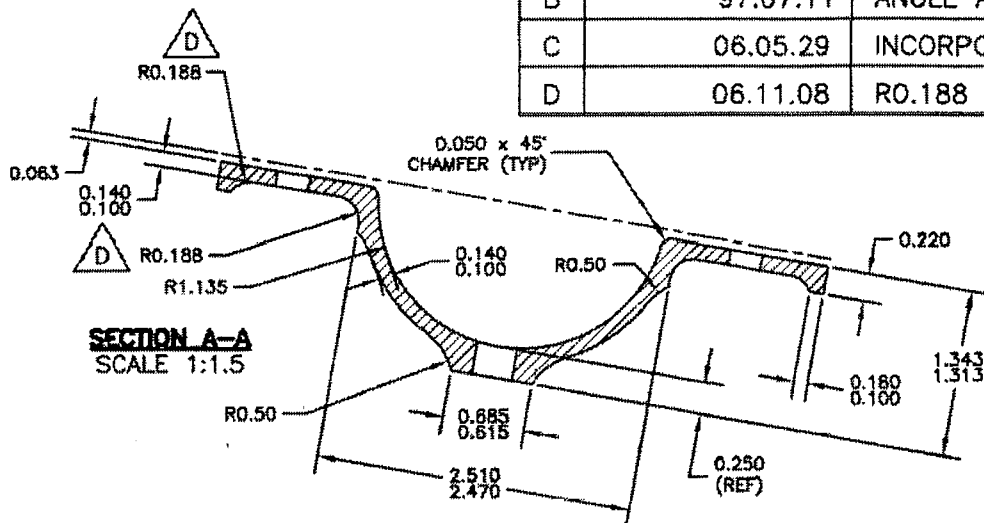



RELEASED  
07.02.12 *PH*

NOTES:

- 1) MATERIAL: ALUMINUM 7075-T7351 (QQ-A-250/12)  
(MAKE FROM D6101-003 SADDLE BILLET, 7075)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT GLOSS WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) BREAK ALL SHARP EDGES 0.010 TO 0.020
- 5) D2661-1 SHOWN (D2661-2 IS OPPOSITE)
- 6) ALL DIMENSIONS ARE IN INCHES

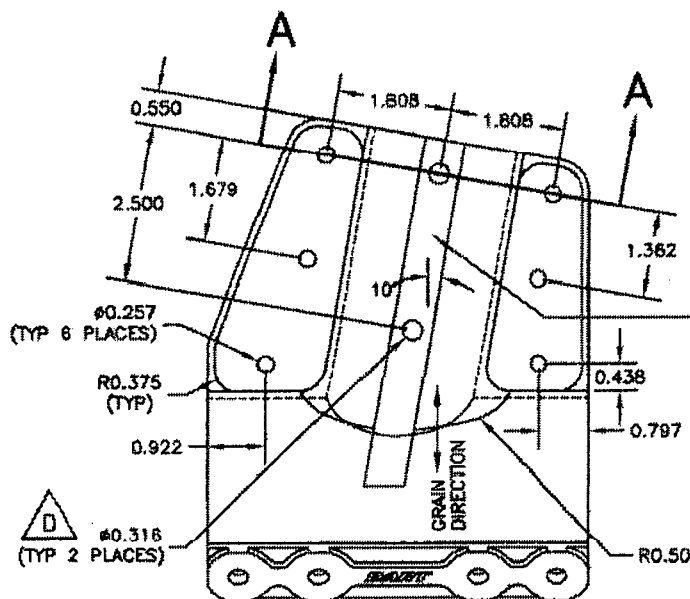

ENGRAVE PART  
NUMBER AND  
BATCH NUMBER  
TO MAX DEPTH  
OF 0.010 WITH  
MIN RADIUS  
OF 0.010

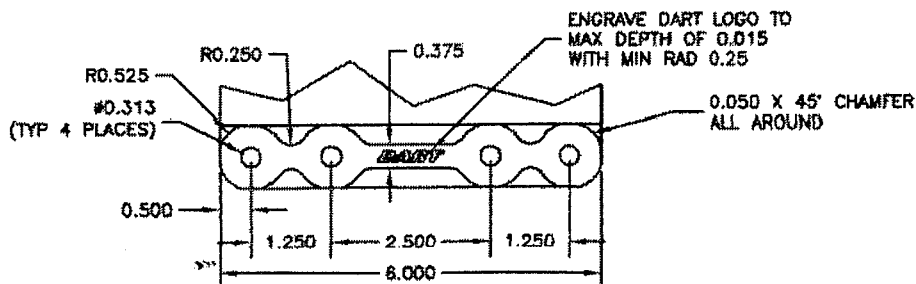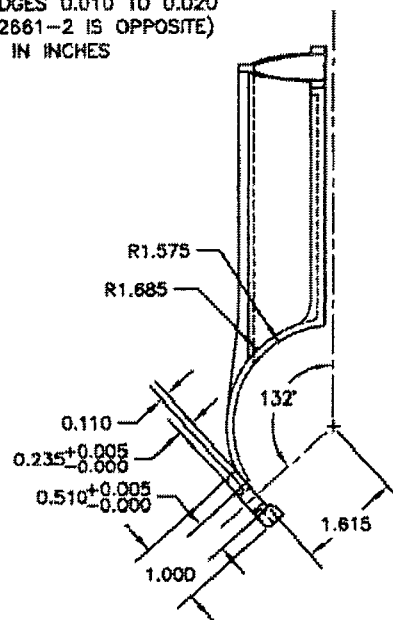

**D2661-1 SADDLE OUTSIDE**

Copyright © 1997 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.